

AP Firmware 3.9.8 RC 2 Release Notes

Release Date: September 29, 2026

Devices Supported

This firmware release supports the following devices:

- AP One AX
- AP One AX Lite
- AP Pro AX
- AP One Mini HW3
- AP One Rugged HW2
- AP One AC Mini HW2
- AP One Flex HW4
- AP One Enterprise HW3

Improvements

Reference	Description
36442	[Beta 1] Added 5 GHz UNII-3 channel support for Jordan.
36028	[Beta 1] Added power source reporting for AP One Enterprise.
36443	[Beta 1] Added support for GCMP, GCMP-256, and CCMP-256 cipher suites for WPA3 Wi-Fi connections.
36438	[Beta 1] Added support for RADIUS over TLS (RadSec).

Resolved Issues

Reference	Description
37885	[RC 2] Fixed an issue where certain Wi-Fi clients could repeatedly disconnect and reconnect on the 2.4 GHz radio of Wi-Fi 6 and Wi-Fi 7 models.
37563	[RC 2] Fixed an issue where duplicate entries appeared in Wireless Client connection history.
37929	[RC 2] Fixed an issue where the 6 GHz radio could fail to start when automatic channel selection chose an invalid 320 MHz channel.
37520	[RC 2] Fixed an issue where the GPIO Input Reset Pin on AP One Rugged HW2 did not respond when triggered.
37872	[RC 2] Fixed an issue where the mesh discovery SSID did not start with factory-default settings.
37487	[RC 1] Fixed an issue where AP One AX and AX Lite devices could crash when the same client attempted to connect to multiple SSIDs operating on the same frequency band.
36770	[Beta 1] Fixed a system stability issue on AP One Enterprise by reducing maximum Wi-Fi transmit power when powered by 802.3at PoE.
36416	[Beta 1] Fixed an issue on AP One Enterprise devices where 5 GHz DFS channels might be incorrectly shown when the country is set to Canada.
36057	[Beta 1] Fixed an issue on AP One Enterprise where disabling Wi-Fi 6 or above on one SSID might not apply correctly when other SSIDs on the same radio still have Wi-Fi 6 or above enabled.
35601	[Beta 1] Fixed an issue that could affect system stability after wireless configuration changes on AP One Rugged HW2, AP One Mini HW3, and AP One Flex HW4.
36107	[Beta 1] Fixed an issue where 160 MHz channel width might be selectable on 5 GHz radios in countries where DFS channels are not available.
36440	[Beta 1] Fixed an issue where the Wi-Fi radio might not start on channel 132, 136, 140, or 165 when Auto channel width was used.
36259	[Beta 1] Fixed the AirSnitch vulnerabilities (CVE-2026-23601, CVE-2026-23808, CVE-2026-23809, CVE-2026-23810, CVE-2026-23811, CVE-2026-23812) when L2 isolation (client isolation) is enabled in the SSID settings.
36813	[Beta 1] Fixed an issue where Wi-Fi clients might remain connected but experience very low or 0 Mbps throughput when the signal became weak.

Known Issues

Reference	Description
37457	[RC 1] Air Monitor does not work on selected Wi-Fi AP devices.

Report an Issue

To report an issue, please open a support ticket at:

<https://www.peplink.com>

For the latest development news and known issues, take a look at our forums:

<https://forum.peplink.com>